



Service Info



LuK GearBox

Diagnosis of the twin-bearing assembly - 02T transmission VAG

Manufacturer: Volkswagen

Transmission type: 02T

Part no.: 462 0055 10

For current listing refer to parts catalog

The two transmission shaft bearings shown in the figure are known as „eyeglass bearings“ due to their side-by-side arrangement together in a single mounting plate.

A defective twin-bearing mounting plate assembly shows no sign of damage on the outside. It usually makes a slight noise, (e.g. whirring, rattling or grinding) whilst the transmission still operates perfectly.

The car-manufacturer recommends use of the following procedure to check the twin-bearing mounting plate assembly:

1. Operate the transmission until it is warmed up.
2. With the clutch engaged and the transmission in neutral, increase the engine speed to approximately 4000 rpm.
3. Step on the clutch pedal and shut the engine off at the same time.
4. If you hear rattling noises which change as the speed of the transmission input shaft slows, the twin-bearing mounting plate assembly is defective.



Twin-bearing mounting plate assembly and needle bearings of a 02T transmission

The increased friction in a defective twin-bearing mounting plate assembly generates excess heat. This can destroy the needle bearing of the positioned 5th gear, and the gear can no longer be engaged. The same thing can happen if there is not enough oil available at the 5th gear. In both cases, the cage is damaged and the needles scatter around the shaft.

Please observe the vehicle manufacturer specifications!

You want more? We can help!

Phone: +44 (0) 1432 264 264*

Fax: +44 (0) 1432 375 760

hfd-info@schaeffler.com

www.schaeffler-aftermarket.co.uk

* Calls from within the UK 08457 001100



SCHAEFFLER

REP>XPERT