

Antriebsriemen & Kits

Technische Information für die Werkstatt

ERGÄNZENDER EINBAUHINWEIS

Zusätzlich zur ESI[tronic]-Einbauanleitung beachten Sie bitte beim Wechsel des Zahnriemens oder des kompletten Kits unten stehende Hinweise:

Gilt für einige Modelle der folgenden Marken:

- ► CITROËN
- ► Lancia


► Fiat

► Peugeot


Fahrzeuge mit 2,0-Ltr.-Common-Rail-Dieselmotor


Bosch-Bestellnummern

- ▶ 1 987 949 435 Zahnriemen
- ▶ 1 987 946 594 Zahnriemen-Kit (ersetzt 1 987 946 358)
- ▶ 1 987 946 965 Wasserpumpen-Kit (ersetzt 1 987 946 435)

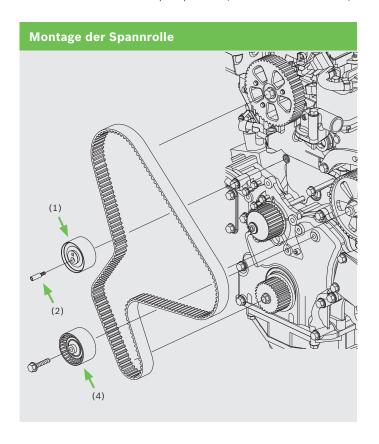

Bei Ausbau der Spannrolle (1) die motorseitige Hülsenschraube (2) unbedingt auf festen Sitz überprüfen. Hat sich die Hülsenschraube gelöst, Sicherungsmittel auftragen und mit dem vorgeschriebenen Drehmoment von 23-27 Nm anziehen.

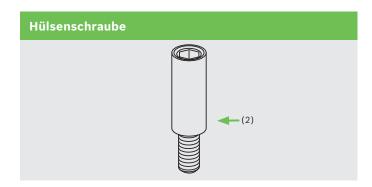

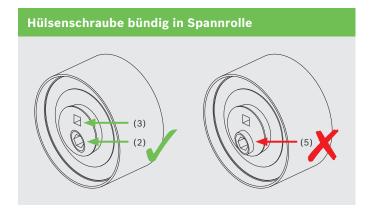

Achtung

Nach dem Aufsetzen der Spannrolle muss die Spannrollenplatte (3) mit dem Rand der Hülsenschraube bündig sein! Die Hülsenschraube darf nicht über die Spannrollenplatte hinausragen (5)! Ansonsten droht eine Fehlausrichtung des Riemens und damit **Gefahr eines Motorschadens!**

Die Anzugsdrehmomente sind ESI[tronic]-M zu entnehmen. Für den Fall, dass für die Montage der Umlenkrolle (4) kein Drehmoment angegeben ist, ist 40-46 Nm zu verwenden. Issue 53 | July 2019



Drive Belts & Kits

Technical Information for Workshops

COMPLEMENTARY INSTALLATION INSTRUCTIONS

Please note the instructions below in addition to the ESI[tronic] installation manual when replacing the timing belt or the complete kit:

Applies to some models of the following brands:

- ► CITROËN
- ► Lancia


► Fiat

► Peugeot


vehicles with 2.0 I common-rail diesel engine


Bosch part numbers

- ▶ 1 987 949 435 Timing belt
- ▶ 1 987 946 594 Timing-belt kit (substitutes 1 987 946 358)
- ▶ 1 987 946 965 Water-pump kit (substitutes 1 987 946 435)

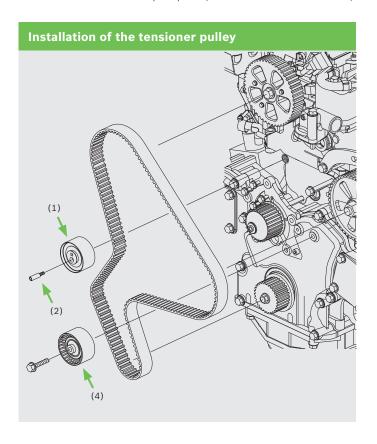

When removing the tensioner pulley (1), make absolutely sure, the sleeve screw (2) on the engine side is seated properly. In case it loosened, apply securing agent and tighten with the specified torque of 23-27 Nm.

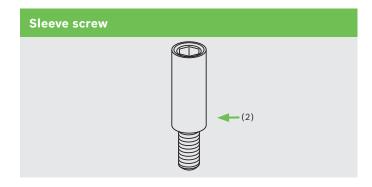

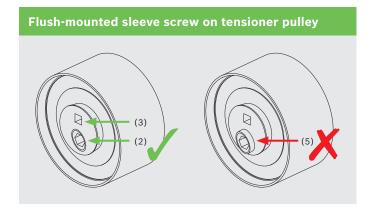

Attention

Once the tensioner pulley has been fitted, the tensioner pulley plate (3) needs to be in line with the sleeve screw!

The sleeve screw must not stand out of the tensioner pulley plate (5)! Otherwise, misalignment of the belt can cause **risk of engine damage!**

The tightening torques are specified in ESI[tronic]-M. In case the torque for the installation of the idler pulley (4) is not specified, apply 40-46 Nm.