


SWAG 40 02 0025

40 15 0029, 40 92 4314

to fit:
 Vauxhall Corsa B, Tigra A,
 Astra F 1.4 16V and 1.6 16V,
 also Vectra B 1.6 16V and 1.8 16V

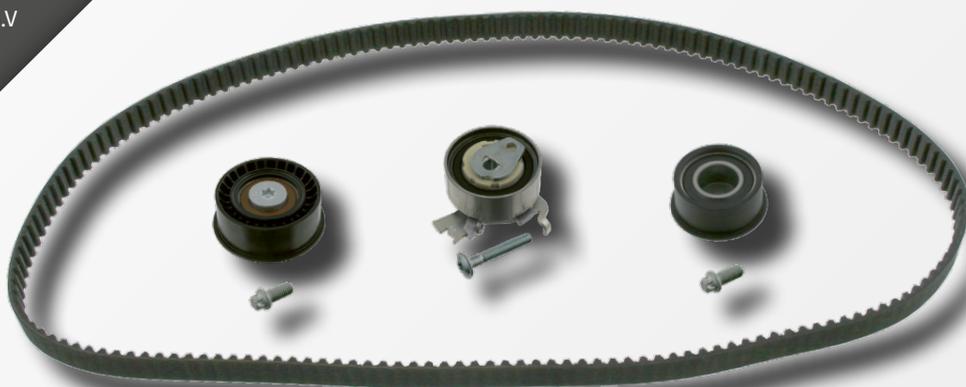

EN

Timing belt kit

Problem

The timing belt can break.

Cause

The design of the belt pulley has been changed by the vehicle manufacturer. The slightly raised section of the old belt pulley (refer to picture 1) can cause a faster deterioration of the timing belt edge. This causes the timing belt to move and be prematurely torn, leading to serious engine damage.

Solution

SWAG recommends: before fitting the timing belt kit SWAG 40 02 0025, check for a raised part of the belt pulley and, if necessary, replace with the new version (refer to picture 2) (Vauxhall plan 5614 430). The new belt pulley will fit correctly to the timing belt, thereby guaranteeing a longer life span.

Please note: when you replace the belt pulley, the crankshaft gear (refer to picture 3) (Vauxhall 0614 546) and the stretch bolt (refer to picture 4) (0614 932 Torx) should also be replaced.

Attention

In any case, however, you must replace the water pump!



Opel 5614 430 plan



SWAG no. 40 15 0029
for the 1.8l engine



SWAG no. 40 92 4314
for the 1.4l and 1.6l 16V engine

For more technical information please visit:
partsfinder.bilsteingroup.com