



Service Info



Coolant pump 538 0314 10

Failure due to additional sealant being applied

Manufacturer: Chevrolet, Opel

Models:

Chevrolet: Aveo, Cruze, Orlando, Trax

Opel/Vauxhall: Adam, Astra, Corsa, Insignia, Mokka

Engines: 1.2, 1.4

Part no.: 538 0314 10

For current listing refer to catalogue media

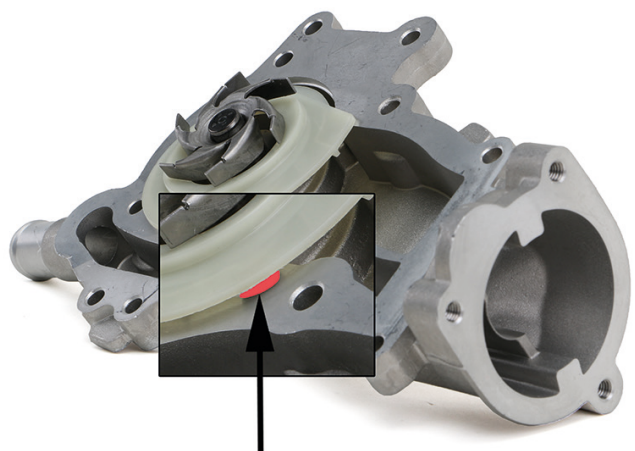


Fig. 2: Distorted plastic shield due to excess sealant

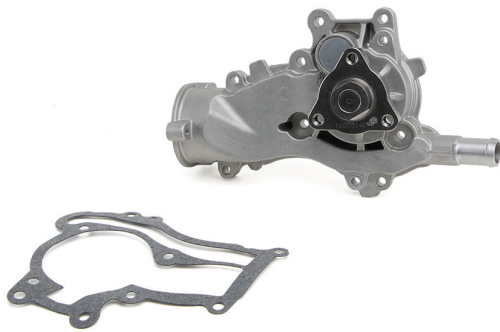


Fig. 1: 538 0314 10 - Coolant pump with accompanying gasket

Coolant pump 538 0314 10 is sealed with a gasket. NO additional sealant may be used during installation.

If additional sealant is used during installation, excess sealant is forced between the coolant housing, and the plastic shield that guides the coolant flow (Fig.2), causing it to distort. In operation the shield is forced against the impeller, damaging or completely destroying the shield, which results in coolant pump failure. Fragments of the plastic shield are passed through the cooling system, and can cause consequential damage.

See also Service Information INA 0162.

Please observe the vehicle manufacturer specifications!

You want more? We can help!
 Phone: +44 (0) 1432 264 264*
 Fax: +44 (0) 1432 375 760
 hfd-info@schaeffler.com
 www.schaeffler-aftermarket.co.uk
 * Calls from within the UK 08457 001100

Issued 07.2017 INA 0167 Technical content subject to change
 OE Manufacturer's names and numbers are used for reference purposes only
 © 2017 Schaeffler Automotive Aftermarket GmbH & Co. KG