

SERVICE-INFO



Assembly instructions for tensioner 534 0412 10

Manufacturer: Ford
Model: Galaxy, Mondeo IV, S-Max
Engine: 1.8 TDCi
OE numbers: 6G9Q-6A228-BC / 1425510
8G9Q-6A228-AA / 1567809
Part no.: 534 0412 10



Image 1: Version 1



Image 2: Version 2

In the vehicles listed, two different versions of the tensioner for the accessory drive are installed ex-works.

Version 1 (**Image 1**) can only be used in combination with a crankshaft vibration damper.

Version 2 (**Image 2**) can be installed both in vehicles with a crankshaft vibration damper and vehicles with a rigid crankshaft pulley.

Schaeffler Automotive Aftermarket therefore only offers the version 2 tensioner.

When installing the tensioner 534 0412 10 offered by Schaeffler Automotive Aftermarket, it is imperative to ensure that the bolt removed from the old tensioner is replaced with the new bolt enclosed (**Image 3**).

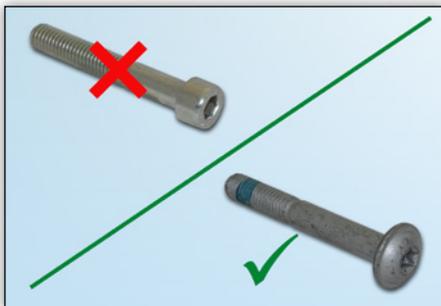


Image 3: bolts

Furthermore, for engines with a crankshaft vibration damper, it must be checked whether this is mechanically OK and there is no damage to the rubber/metal joint.

If the crankshaft vibration damper is defective, it must be replaced.

Attention:

You must use the new bolt enclosed with the tensioner!



Note the specifications of the vehicle manufacturer!

Appropriate spare parts can be found in our on-line catalogue at www.Schaeffler-Aftermarket.com or in RepXpert at www.RepXpert.com.

Issued 09.2011

INA 0081

Technical subject to change

© 2011 Schaeffler Automotive Aftermarket

Any reference to replacement part numbers for vehicle manufacturers is for comparison purposes only.

For further information:

Phone: +44 (0) 14 32 264 264*

Fax: +44 (0) 14 32 375 760

Info@LuK-AS.co.uk

www.Schaeffler-Aftermarket.com

* Calls from within the UK 08457 001100

