



## THE SYMPTOMS

After installing the HN5372 BGA Cylinder Head service kit the oil system could become contaminated with diesel fuel. This can lead to:

- Engine damage.
- Excessive leaking.
- Excessive fuel consumption and poor performance.

## THE REASON

Incorrect installation of the o-rings from the HN5372 BGA Cylinder Head service kit will result in diesel fuel entering the engine's lubrication system, causing engine damage.

## THE SOLUTION

The Injector rings must be installed as per the diagram.

**!** HN5372 CONTAINS TWO DIFFERENT O-RING SIZE SETS. THEY NEED TO BE INSTALLED IN DIFFERENT PLACES.

## HN5372



<http://catalogue.bgautomotive.co.uk/search?type=App&id=HN5372>

## SUMP DILUTION


VAG 1.9TDI PD engine

O-ring installation:

**IMPORTANT**



FAILURE TO PLACE THE O-RINGS CORRECTLY WILL RESULT IN SUMP DILUTION.

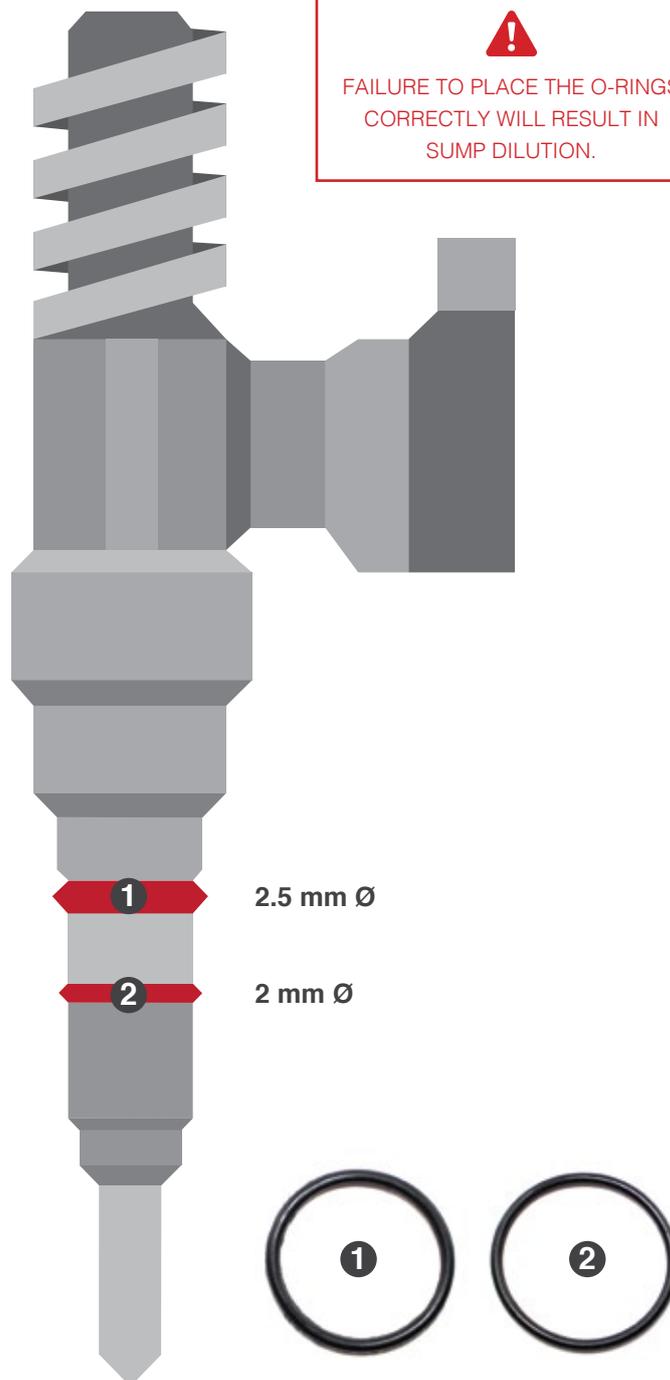

BGA products are to be replaced by an experienced automotive installer. This information is to be used as reference only. Always seek manufacturer specification.

