



Engine:

Nissan - YD22DDTi; YD25 DDTi

BGA recommend when fitting TC0290FK; TC6320FK; TC6321FK; TC6322FK; TC6323FK:

Check the condition of the oil spray jet fitted to the oil pump (Image 3) and change it if required (See below OE part numbers).

BGA recommend when fitting LP6300; LP6305:

Be aware the oil spray jet will require replacement, please see below OE part numbers:

OE Number 13081-AD210 - for LP6300



OE Number 13081-EB70A - for LP6305



TECHNICAL TIP

Ensure during fitment the jet faces towards the timing chain (inwards to engine block). Please see image 1 and image 2.



IMPORTANT INFORMATION

The oil gallery is open until capped by the oil spray jet. Failure to fit either of these parts will cause low oil pressure and could affect the operation of the timing chain tensioner potentially causing catastrophic engine failure.

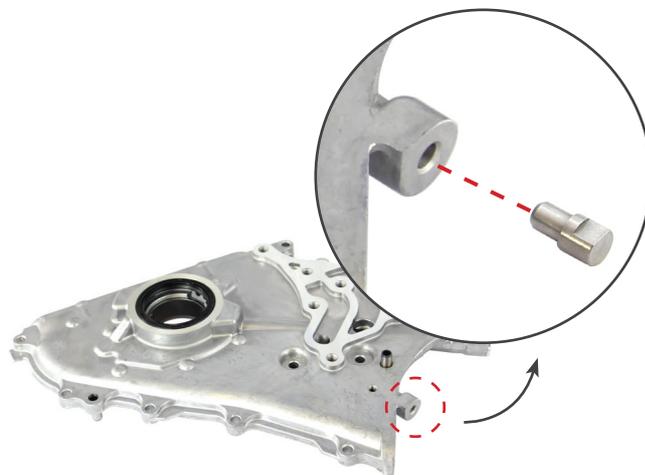


Image 1. LP6300

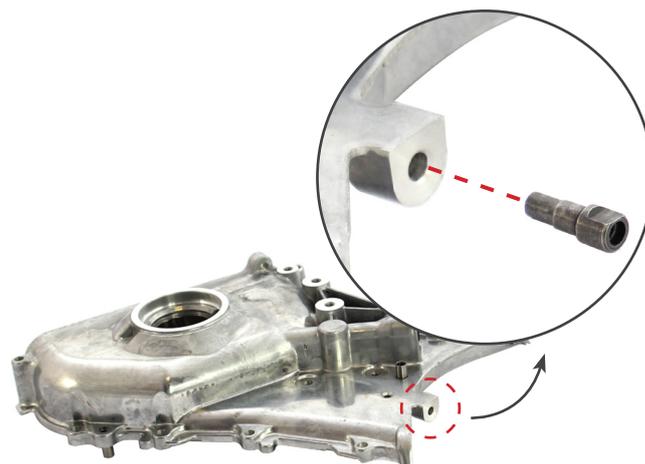


Image 2. LP6305

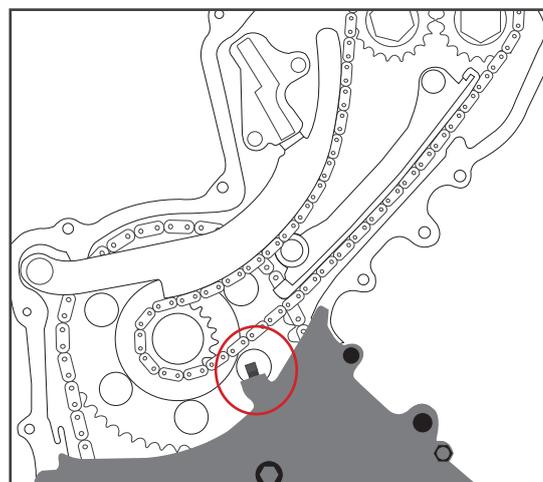


Image 3. Location reference when fitted.



BGA products are to be replaced by an experienced automotive installer. This information is to be used as reference only. Always seek manufacturer specification.

