Technical data

CT 939 K2/K3 & CT1120K1 timing belt kit, used for example in: VW / Audi 2.5 TDI 5 cyl.

Problem:

In accordance with the updated equipment status, the timing belt kit contains a thin washer (diamondcoated) that was not previously installed in the vehicle.


Fig. 1 Washer



Solution:

According to the VW/Audi catalog, this special washer (4) is to be installed between the crankshaft drive wheel (3) and the torsional vibration damper (5). This is intended to improve the co-efficient of friction.

Fig. 2 **Installed position**

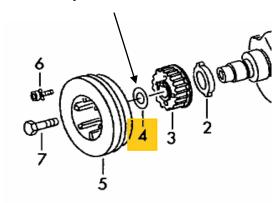

ContiTech Antriebssysteme GmbH Philipsbornstraße 1, D-30165 Hanover, Germany Techn. hotline +49 (0)511 938 -5178 E-mail: frank.wissbroecker@ptg.contitech.de www.contitech.de/aftermarket

