

Risk of confusion between tensioner pulleys 531 0535 20 and 531 0819 10

Manufacturer: Honda, Opel, Vauxhall

Models:

- Honda:** Civic
- Opel:** Astra G, Astra H, Combo, Corsa B, Corsa C, Corsa D, Meriva, Zafira
- Vauxhall:** Astra Mk IV, Astra Mk V, Corsa Mk II, Combo, Meriva

Engines: 1.7 DI, 1.7 DTI, 1.7 CDTi

OE Numbers:

- (1) 56 36 403
97249945
- (2) 56 36 739
97249944
14530-PLZ-Doo

- Part No.:**
- (1) 531 0535 20
 - (2) 531 0819 10

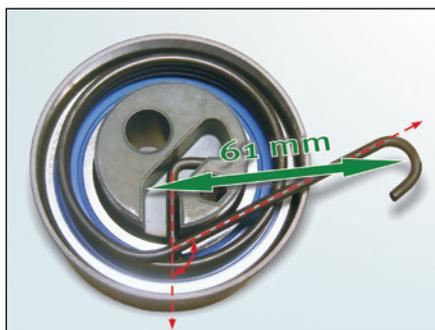


Image 1: 531 0535 20



Image 2: 531 0819 10

When replacing the tensioner pulley with part no. 531 0535 20 or 531 0819 10, precise vehicle allocation must be ensured.

There is very little visible difference between the two tensioner pulleys. The only difference is in the geometry of the tension spring (see Figures 1 and 2).

Important:

The pulleys are not interchangeable! If the wrong tensioner pulley is fitted, the engine could be damaged.



Note the specifications of the vehicle manufacturer!

Appropriate spare parts can be found in our on-line catalogue at www.Schaeffler-Aftermarket.com or in RepXpert at www.RepXpert.com.

Issued 10.2009

INA 0043

Technical subject to change

© 2009 Schaeffler Automotive Aftermarket oHG

For further information:

Phone: +44 (0) 14 32 264 264*

Fax: +44 (0) 14 32 375 760

Info@LuK-AS.co.uk

www.Schaeffler-Aftermarket.com

* Calls from within the UK 08457 001100

