



## Service Info



# Remedy for noises towards the accessory unit drive

Manufacturer: Opel / Vauxhall

Models: Astra H, Signum, Vectra C, Zafira B

Engines: Z18XER

Part no.: 535 0143 10

Due to the strong vibrations of the V-ribbed belt, loud noises may be produced in the vehicles listed above with a rigid alternator belt pulley.

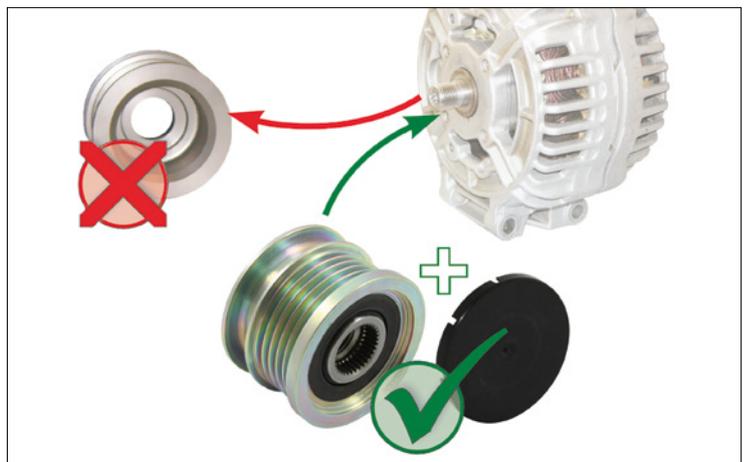


Image 1: Changing a rigid belt pulley on an over-running alternator pulley



Image 2: Over-running alternator pulley 535 0143 10

As a technical solution, Schaeffler Automotive Aftermarket offers an over-running alternator pulley for these vehicles. This reduces the dynamic loads in the accessory unit drive, thus preventing noise emissions.

Schaeffler Automotive Aftermarket recommends that the vehicles affected be retrofitted with an over-running alternator pulley 535 0143 10.

Please note: It is essential that the enclosed installation instructions are observed!

Note the specifications of the vehicle manufacturer!

Spare parts and technical information can be found under [www.schaeffler-aftermarket.com](http://www.schaeffler-aftermarket.com) or [www.RepXpert.com](http://www.RepXpert.com).

Phone: +44 (0) 14 32 264 264\*  
 Fax: +44 (0) 14 32 375 760  
 info@luk-as.co.uk  
 www.schaeffler-aftermarket.com

\* Calls from within the UK 08457 001100

**SCHAEFFLER**  
 AUTOMOTIVE AFTERMARKET

