



SUBJECT

Caution, when mounting a HBU 1 bearing with different seals

PRODUCTS DESIGNATIONS

VKBA 3680

CAR MANUFACTURERS - BRANDS



CITROEN: C4 COUPE, C4 I, C4 I Saloon

PEUGEOT: 307 (3A/C), 307 BREAK (3E), 307 CC (3B), 307 SW (3H), 307 SW Estate Van (3E_, 3H)



SKF Kit


OE number (equivalency)

VKBA 3680


3748.83

SKF has several HBU 1 bearings containing a flat metal shield with an integrated rubber seal to be mounted on the inboard side and a double bended metal shield placed on the outboard side.



Note: If not mounted this way, you will decrease the lifetime of the bearing.

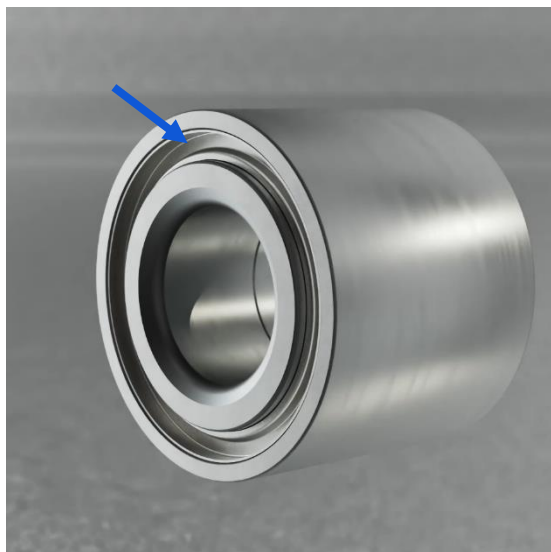


Double bended metal shield –
outboard side

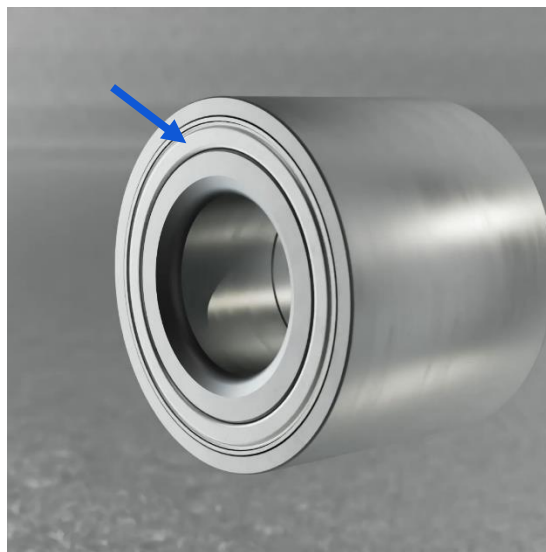

Metal shield with integrated
rubber seal – inboard side

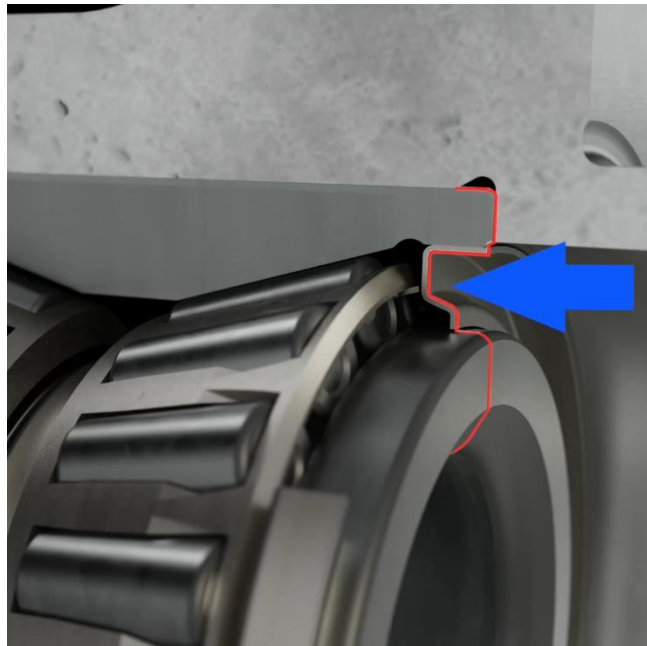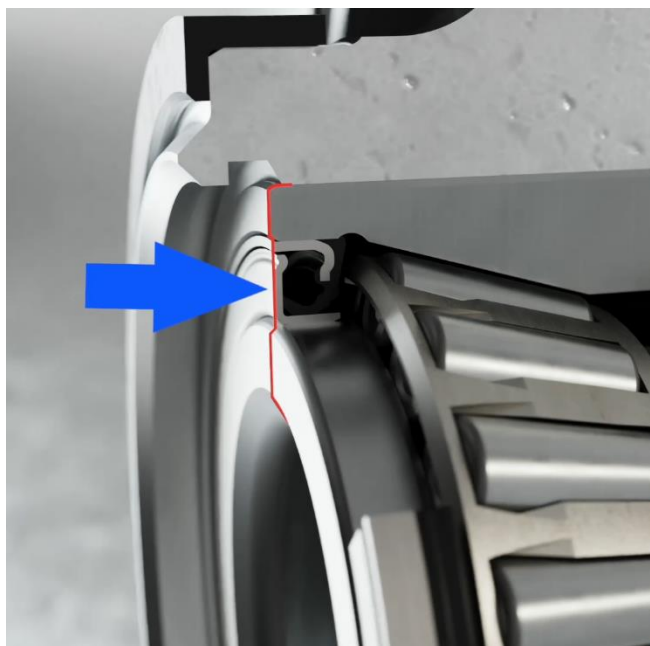

When installing the bearing, always ensure that the flat seal of the wheel bearing is facing inwards (towards the vehicle) and that the seal with the groove is facing outwards (towards the wheel).
Note: Always follow the installation instructions provided by the vehicle manufacturer.

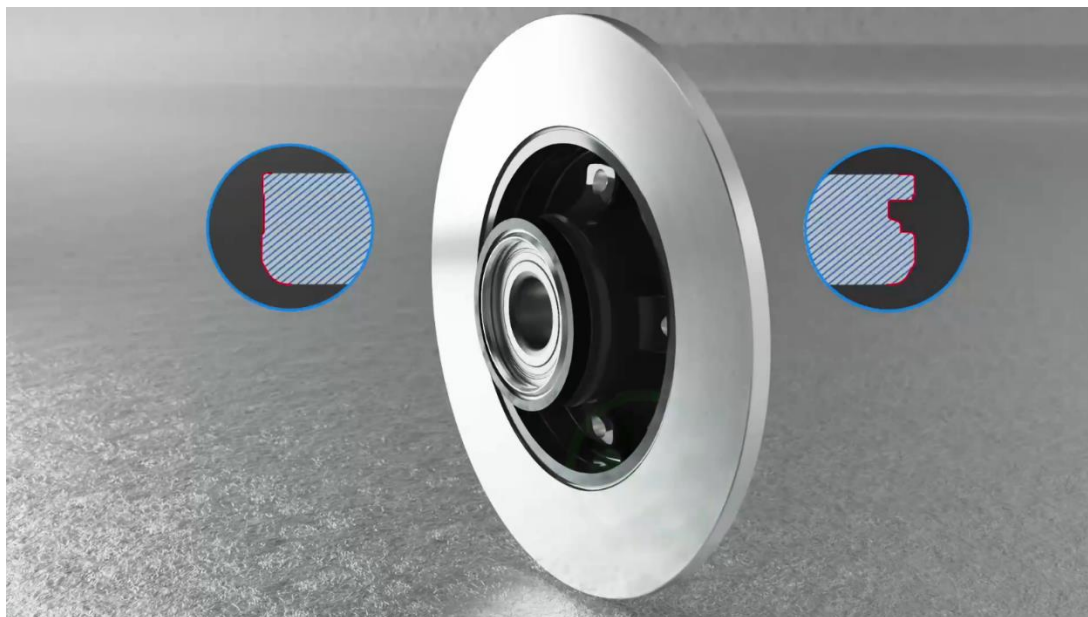

Scan for
mounting video



Scan the QR code or visit
vehicleaftermarket.skf.com
to know more premium
SKF products

Follow us on Social Media



SKFAftermarket



SKFAutomotive



SKFAutomotive



Contact SKF Technical Support
to help resolve your
automotive problems and
answer your questions:
helpline@skf.com

SKF®