



## FAG Service Info



# Strut Mounting kit 815 0082 30

Vehicle

Manufacturer: Mercedes

Model: W 168 (A-Class)

Part no.: 815 0082 30  
816 0001 30

OE-Part no.: 1683200373  
1683230271

See parts catalogue for current assignment

After replacing the strut mounting in the Mercedes A-Class, frequently noises are heard from the strut mounting, the springs jump on turning the steering wheel, the steering becomes stiffer and failure of the new part is even possible. This is caused by failure to comply with the correct installation direction, resulting in tensions.

### Important note!

To simplify installation, the fastening holes already have a thread, in contrast to the original part. Please include mounting kit 816 0001 30 in your order as this contains the screws without tapping characteristics.

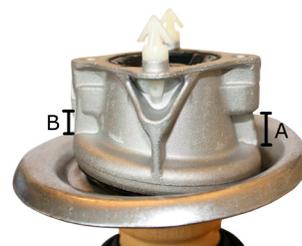


Figure 1

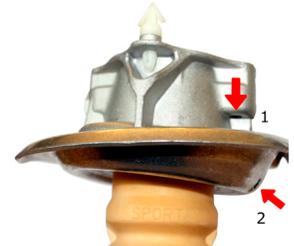


Figure 2



Figure 3



Figure 4

### Please comply with the following instructions for correct alignment of the strut mounting:

- The longer rib (Fig. 1) must be aligned with recess 2 (Fig. 2)
- The threaded hole 1 must be in line with recess 2 (Fig. 3)
- If the part is incorrectly turned through 180° it will be fitted at a tilted angle (Fig. 4) with the above consequences

### Attributes:

- Complete repair kit
- Fastening holes already with thread
- OE-quality part

Please observe the vehicle manufacturer specifications!

**You want more? We can help!**

Phone: +44 (0) 1432 264 264

Fax: +44 (0) 1432 375 760

aftermarket.uk@schaeffler.com

www.repxpert.co.uk