




febi 39942

to fit:
all Chrysler 5-gear automatic transmissions



Repl. no. 521 083 08 AB S1

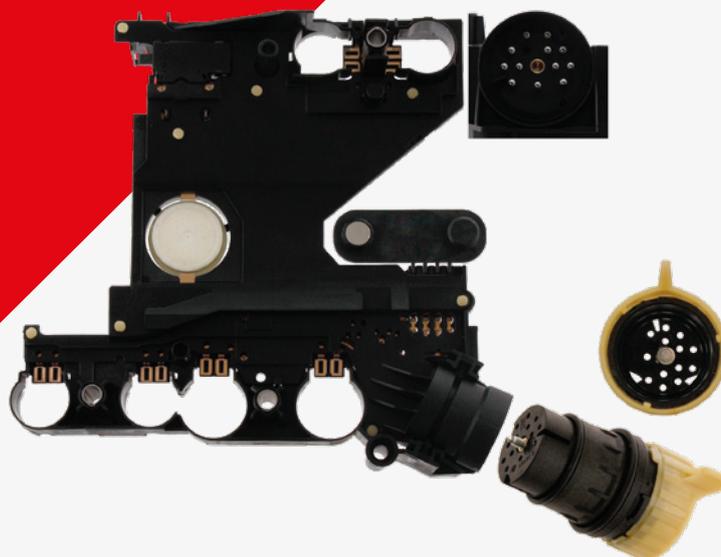

EN

Conductor Plate Kit for automatic transmissions

The sensors of the conductor plate stick together due to deposits in the automatic transmission fluid. This results in gear change malfunctions in the transmission.



Please note!

Always replace the plug at the same time as replacing the conductor plate. Otherwise leaks may occur at the outlet from the conductor plate. As a result the oil perforates the seal and can therefore get into the automatic transmission control unit via the wiring loom and lead to damage in the control unit.



febi 39482

For this reason, febi supplies the complete kit febi 39942 which includes both the conductor plate febi 39482 and also the plug for automatic transmissions febi 36332. This combination enables a professional repair and avoids potential complaints. That saves time and money for both workshop and customer!



febi 36332

febi also supplies the conductor plate and plug separately.

For more technical information please visit: partsfinder.bilsteingroup.com