

New components in the Tensioner SET and the Tensioner KIT for Dacia/Nissan/Renault

Manufacturer: Dacia, Nissan, Renault

Models:
Dacia: Logan
Nissan: Kubistar
Renault: Clio II, Clio III, Espace III, Laguna, Laguna II, Megan I, Megan II, Scenic, Scenic II, Kangoo, Modus, Grand Scenic,

Engines: 1.4, 1.4 16V, 1.6, 1.6 16V, 1.8 16V, 2.0, 2.0 16V

Item no.

- **SET**
 - 530 0092 09
 - 530 0192 09
 - 530 0193 09
 - 530 0342 09
 - 530 0415 09
- **KIT**
 - 530 0092 10
 - 530 0192 10
 - 530 0193 10
 - 530 0342 10
 - 530 0415 10

OE no.

- 530 0092 10 77 01 471 974
- 530 0192 10 77 01 476 674
- 530 0193 10 77 01 472 696
- 530 0342 10 77 01 476 675
- 530 0415 10 77 01 474 359

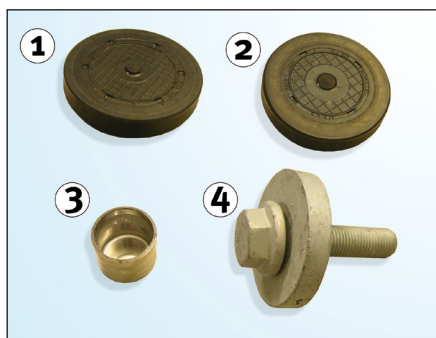


Figure 1: Contents

When replacing the Timing belt using the Tensioner Kit or Set specified above, the components shown in Figure 1 must be changed at the same time. Schaeffler Automotive After-market supplies these components as part of the package as an additional service.

Additional contents:

1. 1x cap for camshaft **57 x 10.5 mm**
2. 1x cap for camshaft **42.5 x 9 mm**
3. 1x cap for crankshaft Locking pin **20 x 16 mm**
4. 1x bolt for crankshaft timing gear

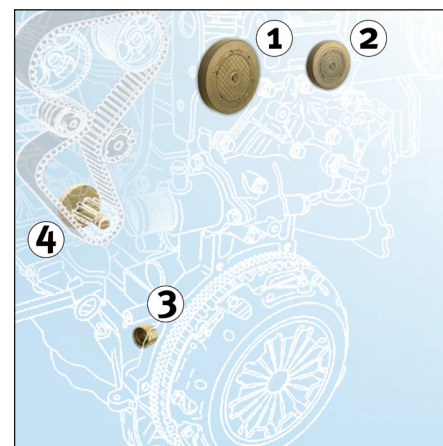



Figure 2: Installation position

 Follow the vehicle manufacturer's instructions!

Appropriate spare parts can be found in our on-line catalogue at www.Schaeffler-Aftermarket.com or in RepXpert at www.RepXpert.com.

Issued 02.2009
INA 0024

Technical subject to change
 © 2009 Schaeffler Automotive Aftermarket oHG

For further information:

Phone: +44 (0) 14 32 264 264*
 Fax: +44 (0) 14 32 375 760
 Info@LuK-AS.co.uk
www.Schaeffler-Aftermarket.com
 * Calls from within the UK 08457 001100

