

Blue Print ADN13013, ADN13207N, ADN13307



to fit:
Nissan Micra K10 Series 1.0, 1.2, 1983>1992

EN


Nissan Micra - K10 Series Clutch

We have found that the Nissan Micra suffers from common problems causing premature clutch failure. Awareness of these problems prior to fitment will allow the correct preventative action to be taken.


Symptoms:

- Jerky/stiff pedal operation
- Clutch drag (poor gear selection)
- Release bearing wear (causing bearing noise)
- Clutch slip

Probable Causes

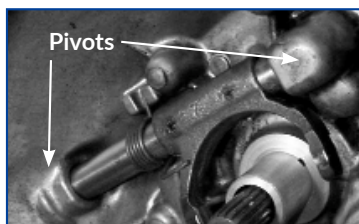

Worn or Seized Release mechanism pivots

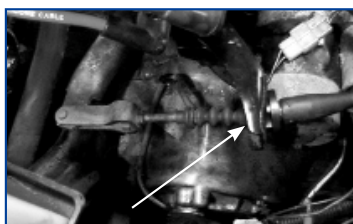

Clutch cable seizure




Transmission guide tube wear

Symptoms:

- Clutch Drag
- Clutch Slip
- Severe clutch disc hub wear


Probable Causes

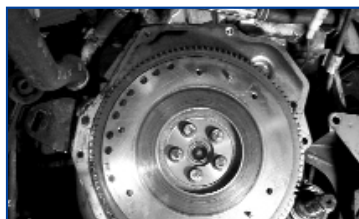

Flywheel wear



Gearbox location dowels
(missing or damaged)

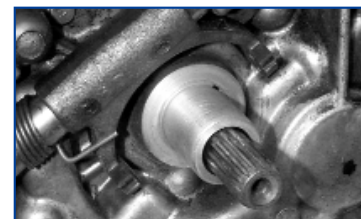

Mainshaft bearing wear (Movement)

For more technical information please visit: partsfinder.bilsteingroup.com