



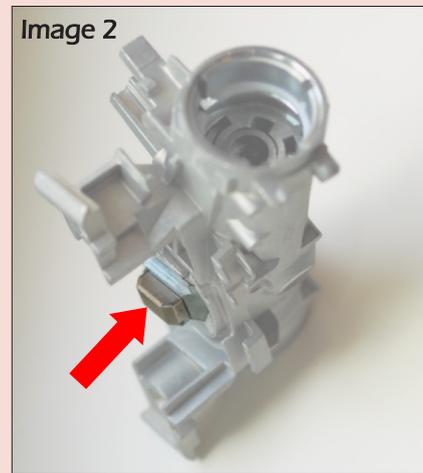

VW steering lock

Invoking the locking mechanism without an inserted lock cylinder results in permanent locking

Doing something that is common practice when exchanging steering wheel locks will lead to lock 1K0 905 851B being rendered useless: due to its construction attributes, testing the lock by pressing the locking mechanism (image 1) without an inserted lock cylinder will cause the bolt to close (image 2) and jam the lock permanently. The part can then be no longer deployed.

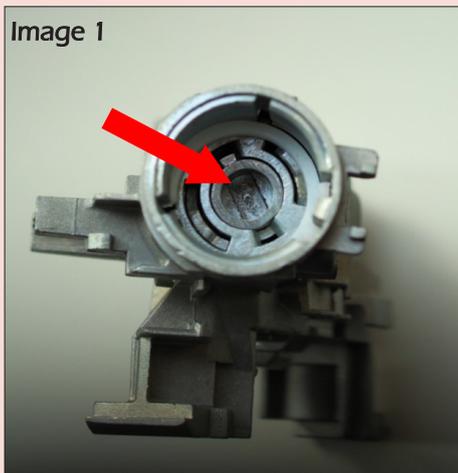

INSTALLATION NOTES

If you wish to test the lock prior to installation, ensure that you first insert a lock cylinder.



ATTENTION

The permanent jamming of the lock occurs due to its specific construction attributes. The locks can also not be reopened by AIC. Locks that are jammed in this manner and rendered useless cannot be accepted as a guarantee claim.

Please refer to and follow the installation instructions of the vehicle manufacturer.



APPLIES TO

Steering lock for	VW, Seat, Skoda & Audi
OE Ref. No.:	1K0 905 851B
AIC Item No.:	56270