## **Fact Sheet**

## INA Engine KIT 560 0004 10

## **Relevant Applications**

Manufacturer: FIAT, ALFA ROMEO, LANCIA

Vehicle: 500, PUNTO, IDEA, SIENA, MITO, YPSILON


Engine: FIAT 1.2 l and 1.4 l

Car Parc: 6.3 million worldwide




Timing belt, tensioner pulley, deflection pulley, water pump including seal, camshaft phasing unit, control valve, all relevant seals, bolts




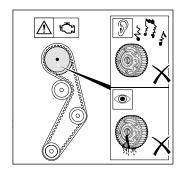


The control valve filter is clogged due to dirt and abrasion. As a result, the camshaft phasing unit is not supplied with sufficient engine oil and is irreparably damaged. This damage is evident in the form of significant noise generation and/or oil leakage.

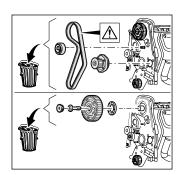

The timing belt must be removed in order to replace the faulty camshaft phasing unit. As the timing belt must be replaced at defined intervals, for economic purposes it usually makes sense to also replace the complete timing belt drive together with the tensioner pulley, the deflection pulley and the water pump. In the event of oil leakage, the timing belt drive must be replaced!

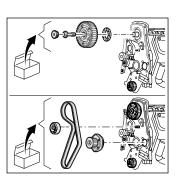

All relevant components (including bolts and seals) are provided in the INA Engine KIT and must always be used for the repair.

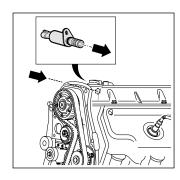

In order to ensure that the new camshaft phasing unit operates correctly, the control valve included in the INA Engine KIT must be used.



