



VKBA 7455

Technical Bulletin - May 2009



SUZUKI Grand Vitarra 1.6, 2.0, 2.5 - ABS fitted



The ABS ring can be destroyed during bearing change process in particular when dismantling the axle and to gain access to components.



As result SKF offers choice of kit to suit mechanics requirement.
VKBA 7455 kit - includes ABS ring - use if broken / damaged
VKBA 3924 kit - no ABS ring – choice if not broken /can be reused

VKBA 7455 Kit content

VKBA 3924 Kit content



Oil Seals



Spacer Ring



Bearing




ABS Ring

VKBA 7455

Component	Quantity
Bearing	1
Spacer Ring	1
Oil Seal	1
ABS Ring	1

Axle design - ABS fitted

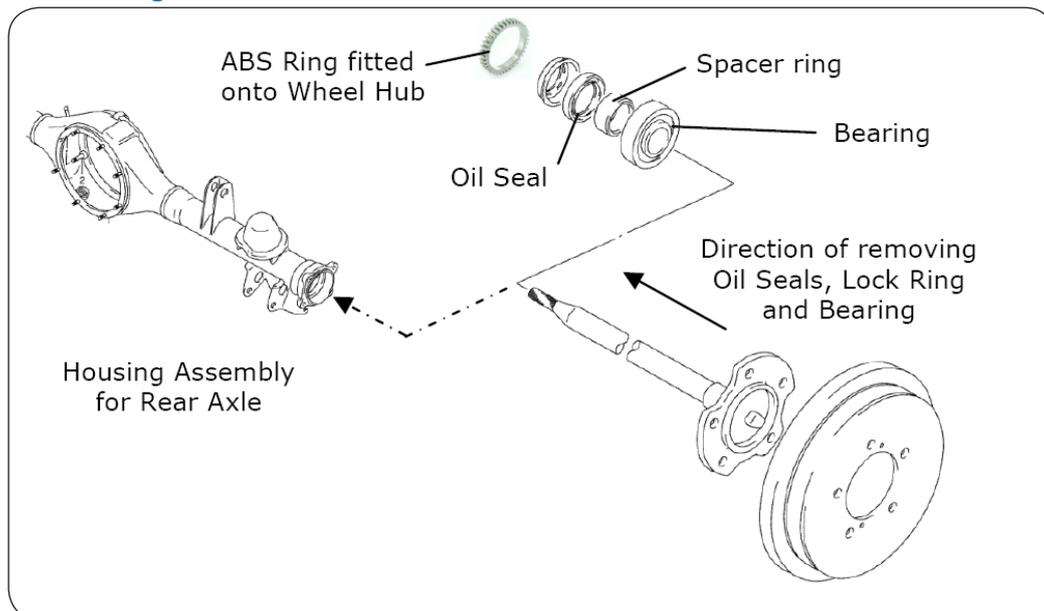

© SKF is a registered trademark of the SKF Group.

© SKF Group 2009

The contents of this publication are the copyright of the publisher and may not be reproduced (even extracts) unless written permission is granted. Every care has been taken to ensure the accuracy of the information contained in this publication but no liability can be accepted for any loss or damage whether direct, indirect or consequential arising out of the use of the information contained herein.

